

# S-Beam Tension and Compression Load Cell Model 8512

Code:	8512 EN
Delivery:	1 - 2 weeks
Warranty:	24 months

# Preliminary data sheet



- Measuring ranges from 0 ... 20 N to 0 ... 880 N
- Non-linearity < 0,1 % F.S.</p>
- Many load cycles
- Protection class IP54
- Excellent price-performance ratio

## Application

Model 8512 bending beam load cells are designed for measuring tension and compression forces. Their high accuracy, low torque sensitivity and thanks to the very flat design make these sensors particularly suitable for use in weighing and dosing technology as well as for laboratory and production use. Extremely simple force application makes the sensor easy to handle. It offers a very favorable price/performance ratio and can be used universally for static and dynamic measurements.

Examples of application:

- Dosing system
- Automated tool testing
- Tension force measurement for wire or thread winders
- ► Test and analysis systems in the pharma industry
- Withdrawal force
- Measuring loads in cable systems

#### Description

The measuring element of this load cell consists of a double bending beam with strain gauges, the resistance of which changes with the application of force. Upon applying a voltage to the strain gauge bridge, the change in the strain gauge resistance is converted into output voltage, which is directly proportional to the force. The strain gauges and the entire measuring element are protected from water spray by metal cover including sealing material.

The tensile or compressive load to be measured is applied to the sensor element through the M6 threaded hole located on each end face. The load can be applied easily, along the sensor axis. This serves to prevent falsification of the measured values. Overload protection can be realized with little effort using a mechanical stop.



# 8512 EN - 2

#### **Technical Data**

Order Code	Measuring range [N]
8512-5020	0 ± 20
8512-5050	0 ± 50
8512-5100	0 ± 100
8512-5220	0 ± 220
8512-5440	0 ± 440
8512-5880	0 ± 880

#### **Electrical Values**

Sensitivity:		
Ranges up to 0 ±100	N 2 mV/V ±0.25 %,	
	positive signal in compression direction	
Ranges up to 0 ±220	N 3 mV/V, ±0.25 %	
	positive signal in compression direction	
Measurement direction: compression and tension direction, calibration in compression direction. The full scale output is likely to be different when used in the tension direction.		
Bridgo registanco:	350 O nominal (doviations are possible)	

Bridge resistance: 350 Ω nominal (deviations are possible) Excitation voltage: max. 10 V DC or AC

## Environmental Conditions

Temperature compensated:	+10 °C +50 °C
Temperature operating:	-40 °C +80 °C
	(moved -5 °C +70 °C)
Temperature effect zero:	$\geq 0.03$ % F.S./K
Temperature effect span:	$\geq 0.05$ % F.S./K
Mechanical Values	
Non-linearity:	±0.1 % F.S.
Relative non-linearity:	±0.25 % F.S.
Hysteresis error:	< ±0.25 % F.S.
Deflection, full scale:	approx. 200 µm
Static overload safe:	120 % of capacity
Overload burst:	> 200 % of capacity
Dynamic performance:	max. 70 % of capacity
Material:	aluminium alloy
Protection class: acc. EN 60529	IP54
Central blind threaded hole at top and bottom: M6	
Resonant frequency (without fitted attachments): > 2	
Weight:	140 g

Electrical termination

Cable specification:

1.5 m, shielded, highly flexible, flame-retardant, suitable for cable harnesses, bend radius 4 x d for fixed cable, 7.7 x d for moveable cable PVC 4 x 0.14, d = 4,8

Cable type:

Wiring code yellow supply voltage (Us+) positive brown supply voltage (Us-) negative signal output (Ua+) white positive signal output (Ua-) green negative



Intended mounting screws: Mounting screws:

M6 strength 8.8 or higher

Us+


Ua+

Us-Ua-

### Installation Instructions:

Smooth flat fixing surface required, load must be applied centrally.

**Dimensional drawing model 8512** 

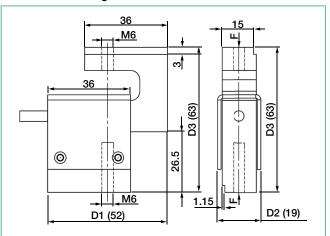

#### The CAD drawing (3D/2D) for this sensor can be imported online directly into your CAD system.

Download via www.burster.com or directly at www.traceparts.com. For further information about the burster traceparts cooperation refer to data sheet 80-CAD-EN.

### **Order Information**

S-beam tension and compression load cell measuring range 20 N Model 8512-5020

### Accessories

Mating connector, 12 pins for burster desktop devices Model 9941 Mating connector, 9 pins for 9163-V3xxxx, 9235 and 9311

Model 9900-V209

Mounting of mating connector on sensor cable upon prevalent use of the load cell

in preferential direction (positive sensor signal in preferential direction) Order Code 99004

opposite to preferential direction (positive sensor signal opposite preferential direction) Order Code 99007

Analysis devices, amplifier and process controller like digital display model 9180, USB sensor interface model 9206, models 9250/9251, In-line amplifier model 9235 and modular amplifier model 9243 refer to section 9 of the catalog.

# Factory Calibration Certificate (WKS)

Calibration of a load cell separately as well as connected to an indicator. Standard is a certificate with 11 points, starting at zero, running up and down in 20% increments covering the complete measuring range for preferential direction. Special calibrations on request. Calculation of costs by base price plus additional costs per point.

Order Code 85WKS-85...