


High Precision Torque Sensor for non-rotating applications

MODEL 8631



NEW
Measuring range
to 1000 N·m

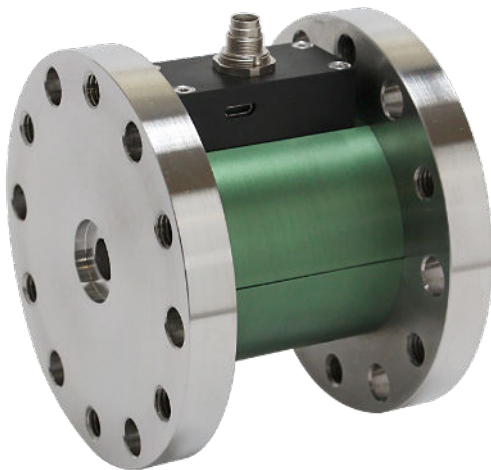

Highlights

- Measuring ranges from 0 ... 5 N·m up to 0 ... 1000 N·m
- Linearity error $\leq 0,1$ % F.S.
- Standardized output signal
- Tare function, filter and average values configurable
- Very high permitted axial load

Options

- Output signal ± 10 V / USB
- burster TEDS
- Dual-range model

Applications

- Test setups for precision mechanics
- Measuring reaction torques for motors
- Measuring car-seat adjustment torques
- Measuring operating torques for door release mechanisms

Product description

This high-precision torque sensor is designed for both static and dynamic measurements on non-rotating parts. The through-hole can be used to feed parts such as cables or Bowden cables through the sensor.

The mounting flanges contain threaded holes and through-holes so that the sensor can be fitted at either end. With no rotating parts, this sensor needs no maintenance when used correctly.

The modular design of this strain-gage sensor allows precise configuration for the desired application.

With the integrated amplifier option, the sensor directly supplies a voltage signal of 0 ... ± 10 V that is proportional to the torque. The sensor can be configured via the micro-USB interface, providing access to, for example, a filter frequency setting, averaging, and a tare function. With the USB option, in addition to the voltage output, the measurement function is available via USB as well. The sensor comes with the DigiVision software for performing measurements and data archiving, with drivers additionally available e.g. for LabVIEW. Integration into custom software is possible via DLL. Examples can be found on our website www.burster.com

The burster TEDS option (electronic data sheet, memory chip with sensor-specific data) allows rapid configuration of compatible evaluation units (instrumentation amplifier, indicator, ...).


Technical Data

8631	-	5005	5010	5020	5050	5100	5200	5300	5400	5500	5800	6001
Measuring range calibrated in N·m from 0 ...		±5	±10	±20	±50	±100	±200	±300	±400	±500	±800	±1000
Accuracy												
Relative non-linearity		0.1 % F.S.										
Relative hysteresis		0.1 % F.S.										
Maximum limit axial load	[N]	500	750	1000	2000	4000	6000	21000				
Maximum limit radial load	[N]	50	75	100	200	400	600	3000				
Spring constant	[N·m/rad]	650	1500	5500	15000	30000	135000	307000				
Mass moment of inertia measuring side	[10 ⁻⁶ kg·m²]	37	38	165	170	465	480	1100				
Electrical values without amplifier / USB												
Sensitivity		1 mV/V						0.3 mV/V	0.5 mV/V		1 mV/V	
Tolerance of sensitivity		0.1 % F.S.						0.15 % F.S.				
Bridge resistance (full bridge)		1000 Ω										
Excitation voltage		5 V (max. 10 V)										
Environmental conditions without amplifier / USB												
Range of operating and nominal temperature		-20 °C ... +80 °C										
Sensitivity of temperature effects		on the zero point 0.015 % F.S./K on the sensitivity 0.010 % F.S./K										
Electrical values with amplifier / USB												
Rated supply voltage range		5 ... 30 V DC (or 5 V via USB)										
DC power consumption		ca. 1 W										
Output voltage at ± rated torque		±10 V										
Output resistance		< 500 Ω										
Insulation resistance		zero (binding capability)										
-3 dB cut-off frequency		5000 Hz										
Ripple		< 50 mV _{ss}										
Calibration signal		10.00 V DC										
Environmental conditions with amplifier / USB												
Range of operating and nominal temperature		0 °C ... +60 °C										
Sensitivity of temperature effects:		on the zero point 0.015 % F.S./K on the sensitivity 0.010 % F.S./K										
Mechanical values												
Dynamic overload safe		recommended 70 % of nominal torque										
Max. operation torque		150 % of nominal torque										
Breakaway torque		300 % of nominal torque										
Alternating load		70 % of nominal torque										
Other		5005	5010	5020	5050	5100	5200	5300	5400	5500	5800	6001
Material:		Housing: made of anodized aluminium Shaft: steel shell 1.4542										
Protection class		acc. EN 60529, IP40										
Weight	[g]	400		930	950	1700	1750	2100				

Geometry

8631	-	5005	5010	5020	5050	5100	5200	5300	5400	5500	5800	6001
L	[mm]	65		70					80			
D	[mm]	60		80					100			
A	[mm]	7		10		12				14		
H	[mm]	72		86		105				107.3		
LK	[mm]	50		70		85				82		
Ø B	[mm]	4.5 (4 x 90°)		5.5 (6 x 60°)		9.0 (6 x 60°)				-		
G	[mm]	4 x M5		6 x M5		6 x M8				8 x M10		
E	[mm]	45°				30°				45°		
F	[mm]	6				12				20		
C	[mm]	10 H7				20 H7				22 H7		
Mounting												
Mounting instructions		Do not exceed the permitted axial and radial forces during fitting and operation (see technical data). Please refer to our operating instructions for detailed information www.burster.com .										

Dimensional drawing Model 8631

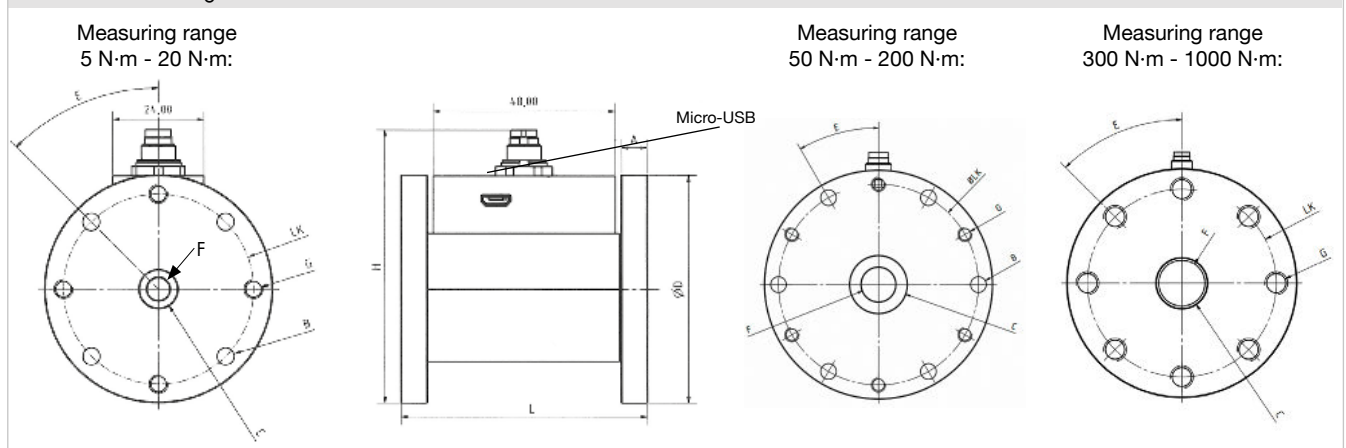


For detailed dimensions, you can find CAD data for the sensor on our website www.burster.com.

Electrical values

7-pin miniature connector, additionally micro-USB interface for configuration/measurement (Option, USB connection cable included)

Wiring Code depends on the options selected		
Pin	Assignment without electronic	Assignment with electronic
1	Bridge supply -	Supply GND
2	Bridge supply +	Supply +5 ... 30 V
3	Shield	Shield
4	Signal +	Output signal ±10 V
5	Signal -	Output signal GND
6	TEDS I/O (option) / NC	Control signal
7	TEDS GND (option) / NC	Switching between ranges (option)

Integrated amplifier with USB interface

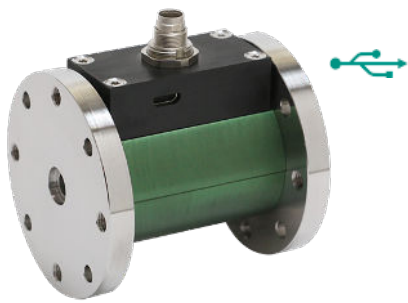

This sensor model comes with a USB port in addition to the 0 ... ± 10 V output. Two versions are available:

- ± 10 V output signal, USB used solely for configuration
- ± 10 V output signal, USB used for both configuration and measurement

When a USB-based measurement is launched, the analog output signal is disabled because it is not possible to use both forms of output simultaneously.

With both versions, the measurement signal can be tared, averaged or filtered. These functions can be set up and/or activated via USB and the free version of DigiVision.

Dual-range version



With integrated amplifier, the dual-range option can be selected. The following subdivisions are available:

Graduation:	1:2	1:4	1:5
Upper scale value of second range			
5 N·m	-	-	1 N·m
10 N·m	5 N·m	-	2 N·m
20 N·m	10 N·m	5 N·m	-
50 N·m	-	-	10 N·m
100 N·m	50 N·m	-	20 N·m
200 N·m	100 N·m	50 N·m	-
300 N·m	-	-	-
400 N·m	200 N·m	-	-
500 N·m	250 N·m	-	-
800 N·m	400 N·m	200 N·m	-
1000 N·m	500 N·m	250 N·m	200 N·m

The second, smaller measuring range can be activated via USB or by applying the operating voltage to pin 7.

DigiVision configuration and analysis software

Features

- Can be used to actuate tare function, with value stored in sensor
- Configuration options for averaging and filters; value stored in sensor
- Intuitive user interface
- Automatic sensor identification
- Sensor calibration data readout

DigiVision Light PC software


DigiVision configuration and analysis software max. 200 measured value/s for one sensor (freely available on our website)

DigiVision Standard PC software

DigiVision configuration and analysis software up to 16 channels Model 8630-P100

PC-Software DigiVision Professional

DigiVision configuration and analysis software including maths functions; up to 32 Model 8630-P200

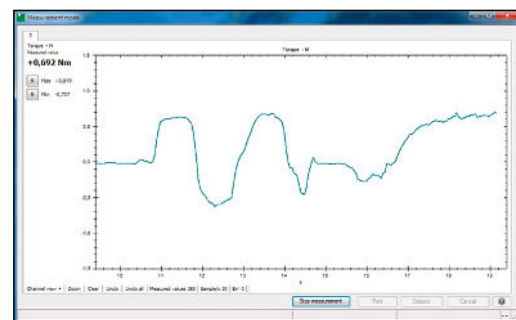

USB measurement option

- Numerical & graphical display and measurement of the physical torque value
- Practical start and stop trigger functions
- 4 limits can be configured for each measurement channel
- MIN/MAX value acquisition
- Automatic scaling
- Measurement reports can be saved as Excel or PDF file
- Archive viewer for displaying sets of curves
- X Multichannel measurements, even with different sensors (e.g. 9206, 8631, 8661) available with standard version

Accessories

Order code		
9900-V594		Mating connection 7 pin
9900-V596		Mating connection 90°-angle
99594-000A-0150030		Connecting cable, length 3 m, other end free
99596-000A-0150030		Connecting cable, length 3 m, plug with 90°-angle, other end free
99141-594A-0150030		Connecting cable for burster desktop instruments with 12 pin socket, length 3 m
99209-586C-0510030		Connecting cable for model 9235, model 7281, model 9307 and model 9311, length 3 m
9900-K358		Micro USB cable, length 1.8 m
8631-P100		DigiVision Standard configuration and analysis software; up to 16 channels
8631-P200		DigiVision Professional with additional configurable maths channel; up to 32 channels
		DigiVision Light configuration and analysis software, max. 200 measured value/s for one sensor (freely available on our website)

Calibration

Manufacturer Calibration Certificate (WKS)		
		Special calibration for clockwise or/and counter clockwise direction torque, in 20 % steps of range up and down.
Calibration Certificate with accreditation symbol		
		Calibration certificate with accreditation symbol per DIN 51309, clockwise or/and anticlockwise torque, with eight steps spaced across the measurement range, increasing and decreasing.

Order Code

Measuring Range		Code			
0 ... ±5 N·m		5	0	0	5
0 ... ±10 N·m		5	0	1	0
0 ... ±20 N·m		5	0	2	0
0 ... ±50 N·m		5	0	5	0
0 ... ±100 N·m		5	1	0	0
0 ... ±200 N·m		5	2	0	0
0 ... ±300 N·m		5	3	0	0
0 ... ±400 N·m		5	4	0	0
0 ... ±500 N·m		5	5	0	0
0 ... ±800 N·m		5	8	0	0
0 ... ±1000 N·m		6	0	0	1

Standard				
0	0	0	3	0

8	6	3	1	-					-	V		0		3	0
---	---	---	---	---	--	--	--	--	---	---	--	---	--	---	---

Standard sensor											
■ Standard sensor, one measuring range											0
■ Dual-range version, graduation 1:5											2
■ Dual-range version, graduation 1:4											3
■ Dual-range version, graduation 1:2											4

Output signals											
■ Output voltage 10 V incl. configuration USB											0
■ Output voltage 10 V incl. USB configuring and measuring USB											1
■ Output signal standardized, mV/V											3
■ Output signal, mV/V with TEDS											4